



**DTB**

Date: February 2, 2005  
Order No.: P-B-27.35/52  
Supersedes:  
Group: 27

**SUBJECT: Model 171.456**  
**Model 171.454/473, Model Year 2006**  
**Model 209.375/475**  
**Model 209.356/456, Model Year 2006**  
**Model 211.070**  
**Model 211.056/087/256/287, Model Year 2006**  
**Model 215.375**  
**Model 219.375**  
**Model 220.170/175**  
**Model 230.475**  
**No Transfer of Power from Automatic Transmission 722.9**

**i Note: For Information Only!**

In the above model vehicles if after replacing the electro-hydraulic control unit on automatic transmission 722.9 (7G-Tronic) you experience the below conditions, this may be caused by an improper installation of the supply pipe for the multi-disc brake B3.

- No gear can be selected in transmission mode “S” and there is no power flow in the transmission
- In transmission mode “C” the vehicle can start off as usual.

To resolve, remove the electro-hydraulic control unit as described in WIS document AR27.19-P-0200w. Before reinstallation, install the supply pipe (Figure 1) per WIS document AR27.19-P-0200w, step 6. Replacement parts are only necessary if the original pipe was damaged during the original installation of the valvebody.

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.



Figure 1 P-B-27.35/52

**Parts Information**

Qty.	Part Name	Part Number
1	Oil guide pipe	A220 277 00 47